

PREPARED BY:
THE ZENGINEER
BUCKY SPARKLE, P.E.
378 MAIN STREET, #2
EASTHAMPTON, MA 01027
www.thezengineer.com
zengineerbucky@gmail.com
(617) 271-4004

PREPARED FOR:
PRIVATE CONDOMINIUM


PROJECT:
PAVEMENT REHABILITATION

PROJECT No.: 2012.06
FILE NAME: Survey for Marketing.dwg

No.	Revision	Date
1	DEMONSTRATION PLAN	3.14.15

EX. CONDITIONS

SHEET 1 OF 1

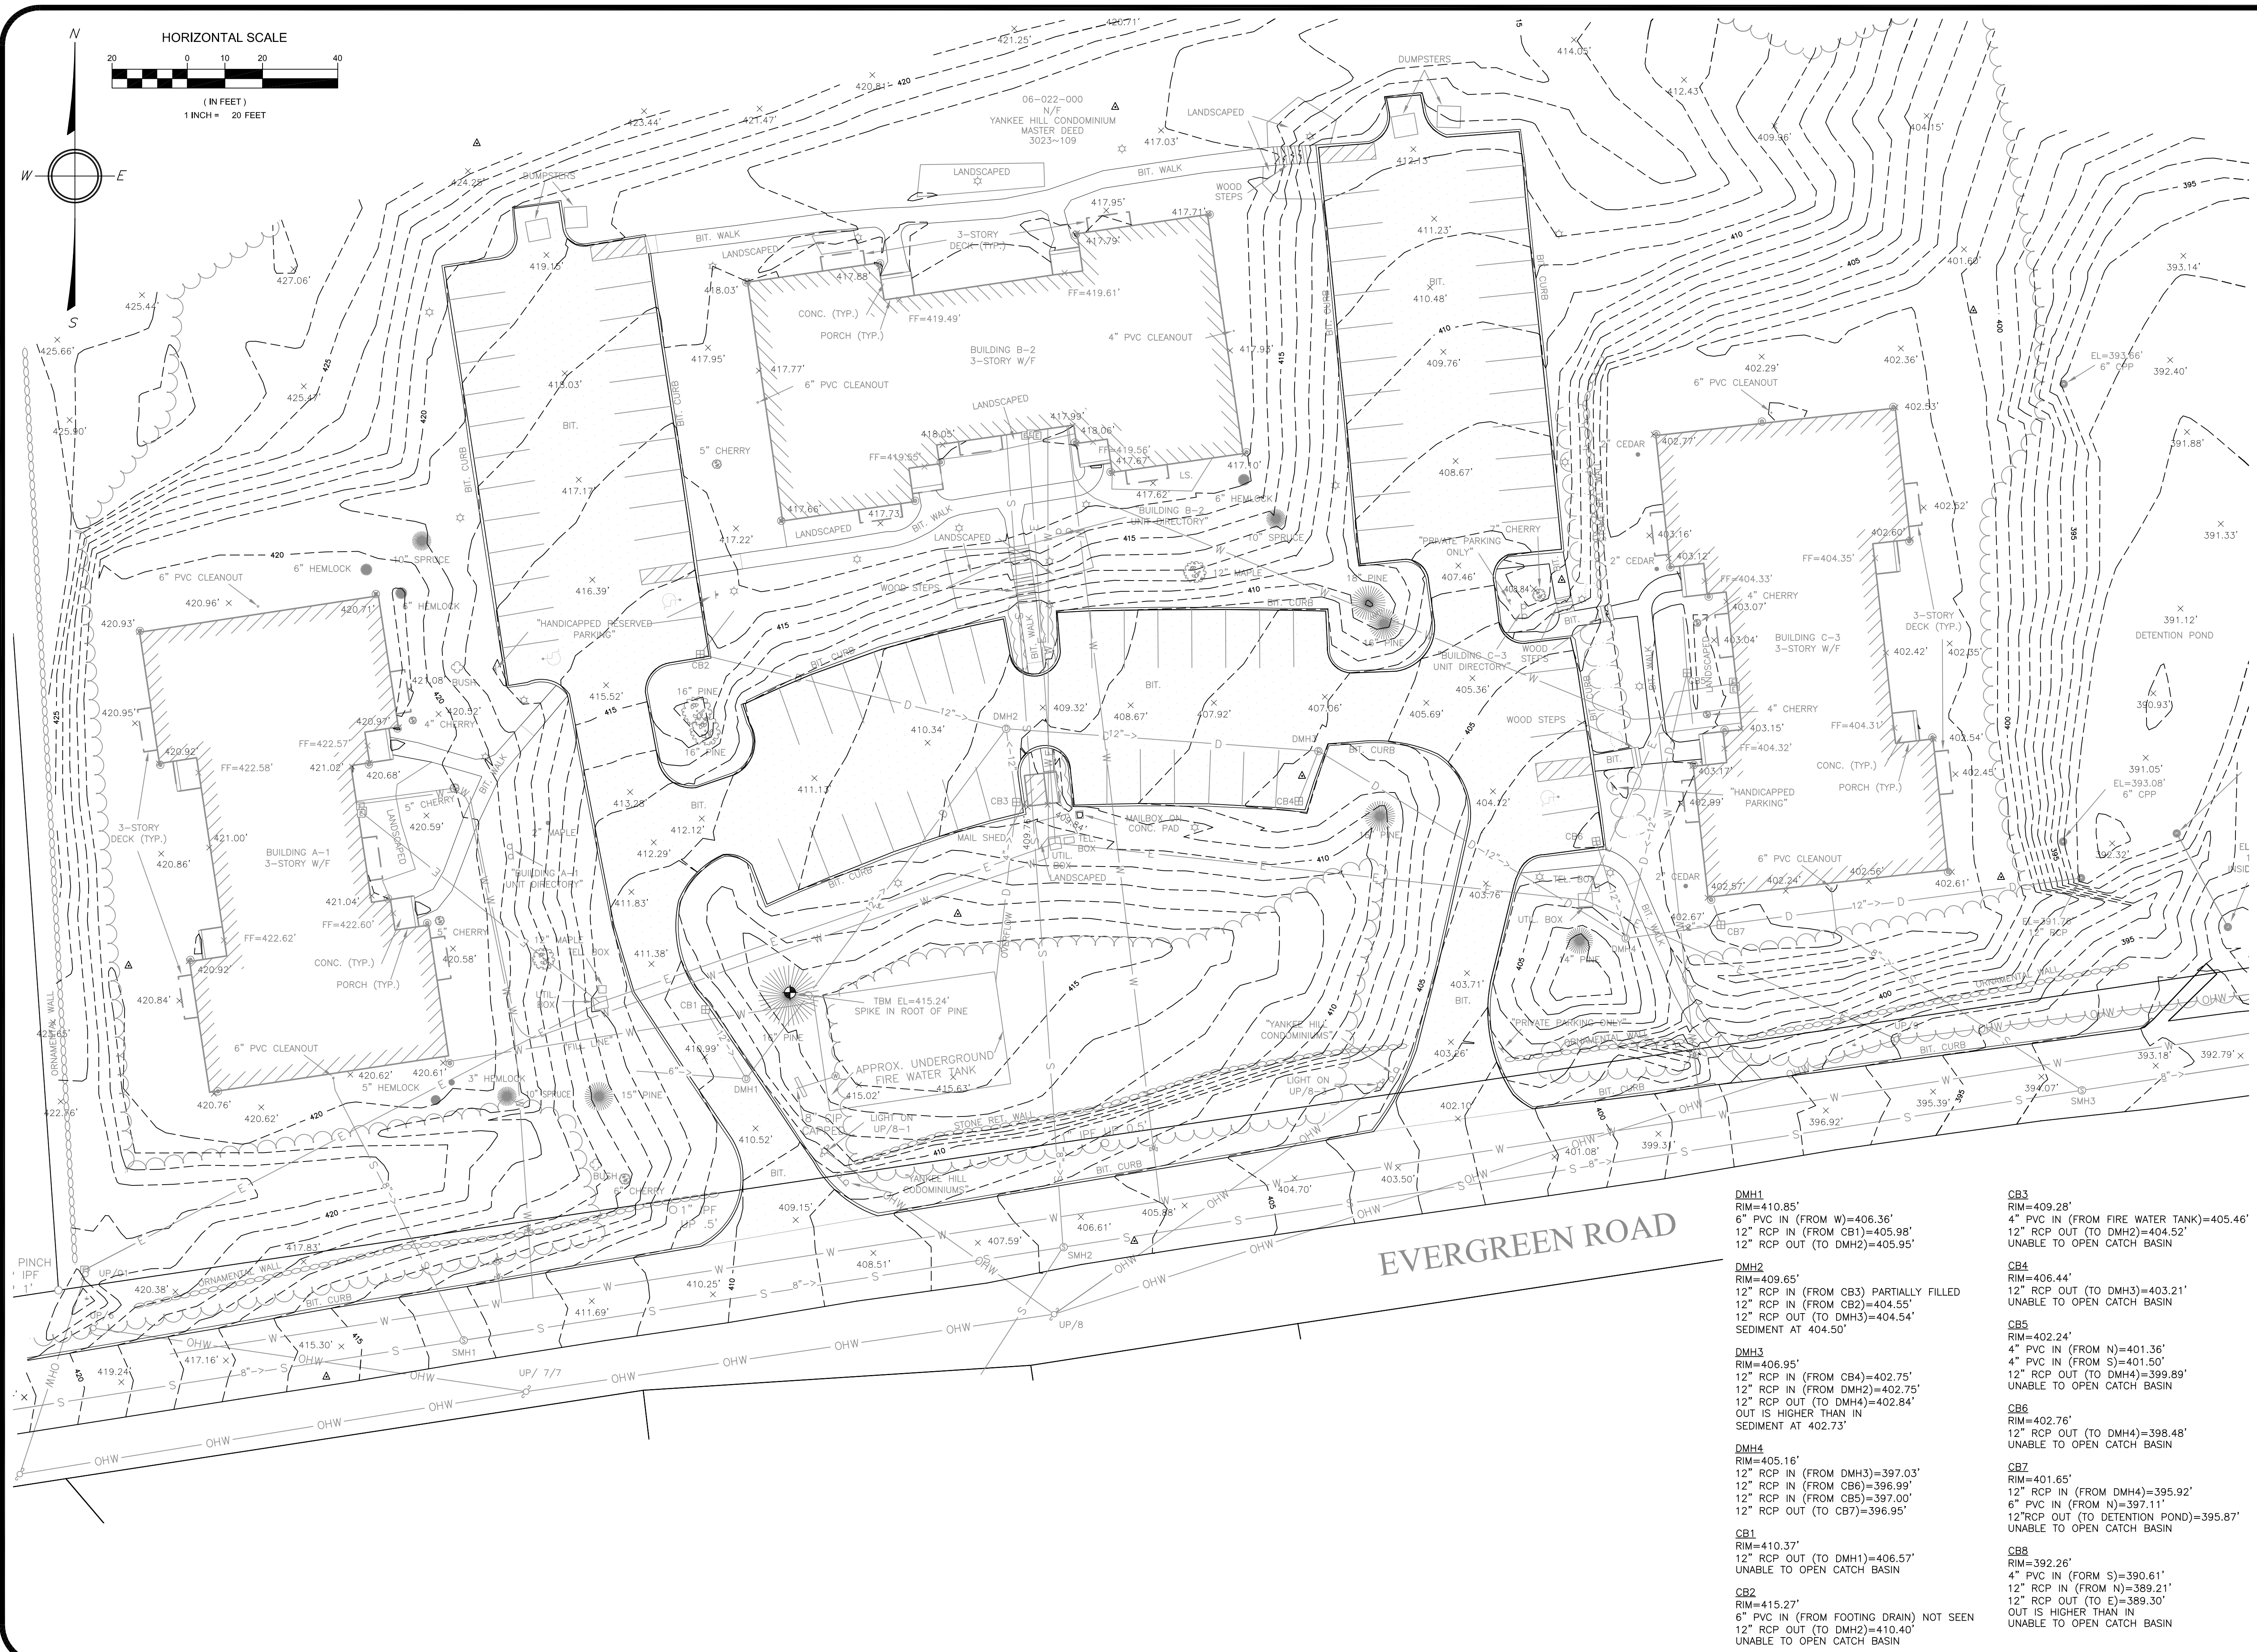

- DMH1**
RIM=410.85'
6" PVC IN (FROM W)=406.36'
12" RCP IN (FROM CB1)=405.98'
12" RCP OUT (TO DMH2)=405.95'
- DMH2**
RIM=409.65'
12" RCP IN (FROM CB3) PARTIALLY FILLED
12" RCP IN (FROM CB2)=404.55'
12" RCP OUT (TO DMH3)=404.54'
SEDIMENT AT 404.50'
- DMH3**
RIM=406.95'
12" RCP IN (FROM CB4)=402.75'
12" RCP IN (FROM DMH2)=402.75'
12" RCP OUT (TO DMH4)=402.84'
OUT IS HIGHER THAN IN
SEDIMENT AT 402.73'
- DMH4**
RIM=405.16'
12" RCP IN (FROM DMH3)=397.03'
12" RCP IN (FROM CB6)=396.99'
12" RCP IN (FROM CB5)=397.00'
12" RCP OUT (TO CB7)=396.95'
- CB1**
RIM=410.37'
12" RCP OUT (TO DMH1)=406.57'
UNABLE TO OPEN CATCH BASIN
- CB2**
RIM=415.27'
6" PVC IN (FROM FOOTING DRAIN) NOT SEEN
12" RCP OUT (TO DMH2)=410.40'
UNABLE TO OPEN CATCH BASIN
- CB3**
RIM=409.28'
4" PVC IN (FROM FIRE WATER TANK)=405.46'
12" RCP OUT (TO DMH2)=404.52'
UNABLE TO OPEN CATCH BASIN
- CB4**
RIM=406.44'
12" RCP OUT (TO DMH3)=403.21'
UNABLE TO OPEN CATCH BASIN
- CB5**
RIM=402.24'
4" PVC IN (FROM N)=401.36'
4" PVC IN (FROM S)=401.50'
12" RCP OUT (TO DMH4)=399.89'
UNABLE TO OPEN CATCH BASIN
- CB6**
RIM=402.76'
12" RCP OUT (TO DMH4)=398.48'
UNABLE TO OPEN CATCH BASIN
- CB7**
RIM=401.65'
12" RCP IN (FROM DMH4)=395.92'
12" RCP IN (FROM N)=397.11'
12" RCP OUT (TO DETENTION POND)=395.87'
UNABLE TO OPEN CATCH BASIN
- CB8**
RIM=392.26'
4" PVC IN (FROM S)=390.61'
12" RCP IN (FROM N)=389.211'
12" RCP OUT (TO E)=389.30'
OUT IS HIGHER THAN IN
UNABLE TO OPEN CATCH BASIN